# **HOMEWRX INSPECTIONS**

(920) 207-5110

Dan@homewrxinspections.com https://www.homewrxinspections.com/





RESIDENTIAL REPORT

1712 S 12th St Sheboygan, WI 53081

08/13/2024



Inspector
Dan Wolf
WAHI Member, AHIT Certified, WI Home
Inspector Lic # 3130-106
(920) 207-5110
Dan@homewrxinspections.com

# TABLE OF CONTENTS

1: Inspection Details	7
2: Electrical	8
3: Exterior	17
4: Roof	22
5: Detached Garage	25
6: Attic	27
7: Bedroom	29
8: Bedroom 2	30
9: Bedroom 3	31
10: Bedroom 4	32
11: Bathroom	33
12: Bathroom 2	34
13: Living Room	35
14: Living Room 2	36
15: Dining Room	37
16: Dining Room 2	38
17: Additional Room	38
18: Kitchen	39
19: Kitchen 2	40
20: Laundry Area	42
21: Stairs/Handrails/Guardrails	43
22: Smoke & CO	43
23: Basement	44
24: Plumbing	47
25: Water Heater	48
26: Heating System	50

Homewrx Inspections Page 2 of 53

# **FULL REPORT**

Note: There is a button (above) for summary section

Unless otherwise noted, this report has been prepared on the date of the inspection by the inspector listed on this report.

Homewrx Inspections, LLC is pleased to present your Home Inspection Report! We like to keep things clear and concise...and get right to the important stuff that you want! But first...the following paragraphs are required by the state of WI. Enjoy:)

For the purposes of the report, "defect," as defined in section 440.97 (2m), Wis. Stats., means a condition of any component of an improvement that a home inspector determines, on the basis of the home inspector's judgment on the day of an inspection, would significantly impair the health or safety of occupants of a property or that, if not repaired, removed, or replaced, would significantly shorten or adversely affect the expected normal life of the component of the improvement. The contract of sale may define "defect" to also include a condition that would have a significant adverse effect on the value of the property, but such a condition may not be labeled a defect in the report unless it meets the definition in section 440.97 (2m), Wis. Stats.

- 1. The summary page is provided for convenience and is not a substitute for reading the entire report and should not be relied upon as the complete list for the client's reference.
- 2. For the purposes of the report, "defect," as defined in section 440.97 (2m), Wis. Stats., means a condition of any component of an improvement that a home inspector determines, on the basis of the home inspector's judgment on the day of an inspection, would significantly impair the health or safety of occupants of a property or that, if not repaired, removed, or replaced, would significantly shorten or adversely affect the expected normal life of the component of the improvement. The contract of sale may define "defect" to also include a condition that would have a significant adverse effect on the value of the property, but such a condition may not be labeled a defect in the report unless it meets the definition in section 440.97 (2m), Wis. Stats.

Color Key:

RED items meet the criteria for Electrical "Defects."

Homewrx Inspections Page 3 of 53

ORANGE items meet the criteria for any other "Defects" (separated from electrical for your convenience) as outlined in the State's definition above. (i.e. Safety Hazards and/or items that could potentially cause further damage to the component or related components of the house if not addressed)

**BLUE** items fall into one of the following categories:

- 1. "Further Evaluation" item(s) could turn into a "defect" depending on the findings of the qualified contractor doing the further evaluation.
- 2. "Repair" item(s) should ideally be repaired, but do not appear significant enough at time of inspection to be considered a "defect"
- 3. "Maintenance" item(s) should undergo normal maintenance to ensure safe and proper functionality so that they do not become a "defect".
- 4. "Monitor" item(s) do not appear to meet the definition of "defect" at time of inspection but could turn into a "defect" in the future. Components and mechanicals that are still functioning but are nearing/beyond normal life expectancy are included in this category as a reminder to budget for whenever the need arises.

Homewrx Inspections Page 4 of 53

# **SUMMARY**

# **REPORT SUMMARY**

Unless otherwise noted, this report has been prepared on the date of the inspection by the inspector listed on this report.

Homewrx Inspections, LLC is pleased to present your Home Inspection Report! We like to keep things clear and concise...and get right to the important stuff that you want! But first...the following paragraphs are required by the state of WI. Enjoy:)

For the purposes of the report, "defect," as defined in section 440.97 (2m), Wis. Stats., means a condition of any component of an improvement that a home inspector determines, on the basis of the home inspector's judgment on the day of an inspection, would significantly impair the health or safety of occupants of a property or that, if not repaired, removed, or replaced, would significantly shorten or adversely affect the expected normal life of the component of the improvement. The contract of sale may define "defect" to also include a condition that would have a significant adverse effect on the value of the property, but such a condition may not be labeled a defect in the report unless it meets the definition in section 440.97 (2m), Wis. Stats.

- 1. The summary page is provided for convenience and is not a substitute for reading the entire report and should not be relied upon as the complete list for the client's reference.
- 2. For the purposes of the report, "defect," as defined in section 440.97 (2m), Wis. Stats., means a condition of any component of an improvement that a home inspector determines, on the basis of the home inspector's judgment on the day of an inspection, would significantly impair the health or safety of occupants of a property or that, if not repaired, removed, or replaced, would significantly shorten or adversely affect the expected normal life of the component of the improvement. The contract of sale may define "defect" to also include a condition that would have a significant adverse effect on the value of the property, but such a condition may not be labeled a defect in the report unless it meets the definition in section 440.97 (2m), Wis. Stats.

Color Key:

RED items meet the criteria for Electrical "Defects."

ORANGE items meet the criteria for any other "Defects" (separated from electrical for your convenience) as outlined in the State's definition above. (i.e. Safety Hazards and/or items that could

Homewrx Inspections Page 5 of 53

potentially cause further damage to the component or related components of the house if not addressed)

#### BLUE items fall into one of the following categories:

- 1. "Further Evaluation" item(s) could turn into a "defect" depending on the findings of the qualified contractor doing the further evaluation.
- 2. "Repair" item(s) should ideally be repaired, but do not appear significant enough at time of inspection to be considered a "defect"
- 3. "Maintenance" item(s) should undergo normal maintenance to ensure safe and proper functionality so that they do not become a "defect".
- 4. "Monitor" item(s) do not appear to meet the definition of "defect" at time of inspection but could turn into a "defect" in the future. Components and mechanicals that are still functioning but are nearing/beyond normal life expectancy are included in this category as a reminder to budget for whenever the need arises.

- ⚠ 2.2.1 Electrical Wiring: Handyman Wiring
- △ 2.2.2 Electrical Wiring: Live Knob and Tube Wiring
- ⚠ 2.2.3 Electrical Wiring: Open Junction Box(s)
- ▲ 2.2.4 Electrical Wiring: Light(s)/Switch(es) Not Working
- △ 2.3.1 Electrical Receptacles: Ungrounded 3-Prong Receptacle(s)
- △ 2.3.2 Electrical Receptacles: GFCI Protection Not Present In Recommend Location(s)
- ▲ 2.3.3 Electrical Receptacles: Receptacle(s) Not Working
- ⚠ 2.4.1 Electrical Main Electric Panel: Double tapped neutral(s) at upper unit electric panel
- △ 2.5.1 Electrical Main Electric Panel 2: Double tapped neutral(s)
- 2.6
- 2.6.1 Electrical Sub Panel: Further evaluation Electrical sub panel in garage is not accessible due to fridge in the way.
- 3.1.1 Exterior Walkways: Trip Hazard(s) Observed At Walkways
- 3.2.1 Exterior Driveway/Parking: Trip Hazard(s) Observed at Driveway
- 3.6.1 Exterior Patio: Area(s) At Patio Are Pitched Toward Home
- 3.8.1 Exterior Balcony Porch: Railing At Balcony Porch Is Loose/Wobbly
- (JC)
- 3.11.1 Exterior Soffit: Peeling paint at exterior wooden soffit/facia. (Painting in progress at time of inspection)
- 3.16.1 Exterior Windows: Cracked Glass Observed At Basement Window(s)
- 3.16.2 Exterior Windows: Cracked Glass Observed At Window(s)
- 3.17.1 Exterior Exterior Doors: Fogged Window Pane(s) Observed At Exterior Door(s)

Homewrx Inspections Page 6 of 53

- 4.2.1 Roof Coverings: Cracks observed at slate shingles. (Some areas of roof not visible for inspection)
- 5.14.1 Detached Garage Automatic Opener: Recommend Proper Installation Of Photo Eyes
- 6.3.1 Attic Framing: Cracked cross member observed in attic
- **№** 8.3.1 Bedroom 2 Floors: Heaved flooring observed in 2nd floor west bedroom and in basement area(s)
- 11.8.1 Bathroom Sink(s): Second floor batheoom sink Drained Slowly
- 12.8.1 Bathroom 2 Sink(s): Handyman plumbing observed below first floor bathroom sinks
- 19.2.1 Kitchen 2 Walls & Ceiling: Moisture stains/discoloration observed on wall below 1st floor kitchen sink and in basement below that area. (Moisture meter indicates some Moisture content present in wall)
- 19.11.1 Kitchen 2 Appliances: Range exhaust hood is located <18" Above Stovetop
- 20.1.1 Laundry Area General Information: Clothes chute is a potential fall hazard for children/small pets
- 21.1.1 Stairs/Handrails/Guardrails Stairs/Handrails/Guardrails: Basement stairs are slanted.
- 23.1.1 Basement Foundation Walls: Loose bricks/damaged area observed at foundation wall
- 23.2.1 Basement Support Structure: Modified/damaged floor joist(s) observed
- 23.2.2 Basement Support Structure: Temporary/unanchored columns observed in basement.
- 24.2.1 Plumbing Water Supply & Drain Piping: Further Evaluation -or- Monitor/Budget Item Galvanized And/Or Cast Iron Plumbing Pipes Are Beyond Normal Life Expectancy
- 25.1.1 Water Heater Water Heater: Monitor/Budget Item Water Heater Is Nearing Or Beyond Normal Life Expectancy
- 25.2.1 Water Heater Water Heater 2: Monitor/Budget Item Water Heater Is Nearing Or Beyond Normal Life Expectancy
- 26.1.1 Heating System Furnace: Monitor/Budget Item Nearing Or Beyond Normal Life Expectancy
- 26.2.1 Heating System Boiler : Further evaluation/ Monitor/Budget Item Nearing Or Beyond Normal Life Expectancy
- 26.2.2 Heating System Boiler : Missing/Improper Extension Pipe At Pressure Relief Valve

## 1: INSPECTION DETAILS


#### **Information**

Overview: Introduction Video
Introduction Video

Overview: Occupancy
Upper is vacant. Lower is occupied.

Overview: Type of Building
Two-Family

Homewrx Inspections Page 7 of 53

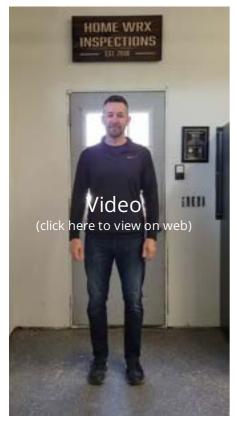

Overview: Style 2 Story

**Overview: Ground Cover**Dry

**Overview: Weather Conditions**Sunny/Clear

Overview: Approximate Temperature (Degrees Fahrenheit) 80's

2: ELECTRICAL

#### **Information**

Electric Meter / Electric Service Entrance: Type

Overhead

Electric Meter / Electric Service
Entrance: Condition

Satisfactory

**Wiring: Condition** 

Recommend Evaluation/Repair

Homewrx Inspections Page 8 of 53



Light in garage is disconnected

**Receptacles: Condition** Recommend Evaluation/Repair

Main Electric Panel: Amperage/Voltage

100 AMP, 240V

**Main Electric Panel: Appears Bonded** 

Yes

**Main Electric Panel: Main Wires** 

Copper

Main Electric Panel 2: Main Panel Location

Basement

**Main Electric Panel 2: Breakers/Fuses** Circuit Breakers

**Main Electric Panel 2: GFCI Breaker(s) Present** 

No

Main Electric Panel 2: Branch

Wires

Copper

**Panel** 

No

Main Electric Panel: Main Panel

Upper unit

Location

**Main Electric Panel:** Breakers/Fuses Circuit Breakers

**Main Electric Panel: GFCI Breaker(s) Present** 

No

Main Electric Panel: Branch Wires Main Electric Panel: Panel

Copper

**Main Electric Panel 2: Adequate** Clearance to Panel

Yes

**Main Electric Panel 2: Appears** Grounded

Yes

Main Electric Panel 2: AFCI

Breaker(s) Present

No

Main Electric Panel 2: Panel

Condition

Recommend Evaluation/Repair By Qualified Electrician

Sub Panel: Adequate Clearance to Sub Panel: Panel Condition

Recommend further evaluation

Main Electric Panel: Adequate

**Clearance to Panel** 

Yes

**Main Electric Panel: Appears** 

Grounded

Yes

**Main Electric Panel: AFCI** Breaker(s) Present

No

Condition

Recommend Evaluation/Repair By Qualified Electrician

**Main Electric Panel 2:** Amperage/Voltage 100 AMP, 240V

**Main Electric Panel 2: Appears** 

Bonded Yes

**Main Electric Panel 2: Main Wires** 

Copper

**Sub Panel: Sub Panel Location** 

Garage

**Sub Panel 2: Sub Panel Location** 

**Basement** 

Homewrx Inspections Page 9 of 53 1712 S 12th St -

**Sub Panel 2: Adequate Clearance Sub Panel 2: Breakers/Fuses** 

Sub Panel 2: Breakers/Fus Circuit Breakers **Sub Panel 2: Appears Grounded** 

Yes

**to Panel** Yes

**Sub Panel 2: Branch Wires** 

**Sub Panel 2: Panel Condition** 

Satisfactory

**Electric Meter / Electric Service Entrance: General** 

Photo(s)

Copper





Main Electric Panel: General Photo(s)





Main Electric Panel 2: General

Photo(s)

Homewrx Inspections Page 10 of 53



**Sub Panel 2: General** Photo(s)





# De ciencies


Homewrx Inspections Page 11 of 53

2.2.1 Wiring

## ▲ Electrical Defects

#### **HANDYMAN WIRING**

Handyman wiring describes any wiring that does not appear professionally installed by a qualified electrician. Some examples of handyman wiring include: Extension cord wiring in place of permanent wiring, exposed wires run below ceiling joists and not in conduit, wires spliced outside of junction boxes, etc. Recommend evaluation/repair(s) by qualified electrician.

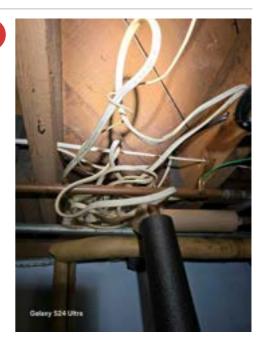

2.2.2 Wiring

#### LIVE KNOB AND TUBE WIRING



Live Knob and Tube wiring observed. Knob and Tub wiring is an older form of wiring and can pose a safety hazard in some circumstances. Recommend evaluation/repair as recommended by qualified electrician.



Homewrx Inspections Page 12 of 53

2.2.3 Wiring

## **OPEN JUNCTION BOX(S)**



Open junction box(es) observed. Recommend boxes be properly stuffed and covered by qualified electrician.



In first floor closet near back entry area

2.2.4 Wiring

#### LIGHT(S)/SWITCH(ES) NOT WORKING



1ST FLOOR WEST BEDROOM, BASEMENT

One or more light(s)/switch(es) were not working at time of inspection. Recommend replacing bulb(s). If light(s) are still not working properly, recommend evaluation/repair by qualified electrician.







Homewrx Inspections Page 13 of 53

2.3.1 Receptacles

#### **UNGROUNDED 3-PRONG RECEPTACLE(S)**



SEVERAL THROUGHOUT

Ungrounded 3-prong electrical receptacle(s) were observed throughout the home. Only a sampling of electrical receptacles were tested. Recommend evaluation/repair by qualified electrician.







2.3.2 Receptacles

## GFCI PROTECTION NOT PRESENT IN RECOMMEND LOCATION(S)



GARAGE, 2ND FLOOR KITCHEN, 1ST FLOOR KITCHEN

Receptacle(s) without GFCI protection were observed in locations where GFCI protection is recommended. For enhanced safety, recommend evaluation/repair by qualified electrician.







Homewrx Inspections Page 14 of 53

2.3.3 Receptacles

## **RECEPTACLE(S) NOT WORKING**



EXTERIOR, 2ND FLOOR LIVING ROOM, 1ST FLOOR EAST BEDROOM, BASEMENT

Electrical receptacle(s) not working. Recommend verifying if outlet is operated by a switch or recommend evaluation/repair by qualified electrician.










Homewrx Inspections Page 15 of 53

2.4.1 Main Electric Panel



# DOUBLE TAPPED NEUTRAL(S) AT UPPER UNIT ELECTRIC PANEL

Double tapped neutral(s) observed at electric panel. Recommend evaluation/repair by qualified electrician.

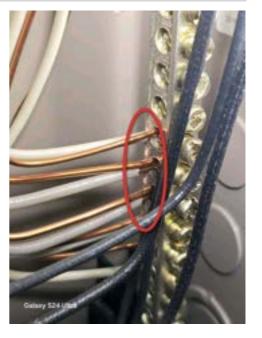


2.5.1 Main Electric Panel 2

#### **DOUBLE TAPPED NEUTRAL(S)**



Double tapped neutral(s) observed at electric panel. Recommend evaluation/repair by qualified electrician.

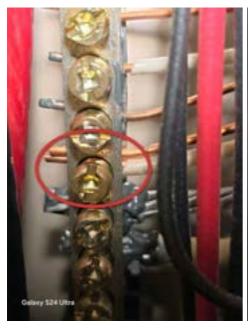



Homewrx Inspections Page 16 of 53

2.6.1 Sub Panel

#### **FURTHER EVALUATION - ELECTRICAL SUB PANEL IN** GARAGE IS NOT ACCESSIBLE DUE TO FRIDGE IN THE WAY.

Recommend further evaluation and repairs as needed by qualified contractor.





## 3: FXTFRIOR

#### **Information**

Walkways: Material

Concrete

**Driveway/Parking: Condition** 

Recommend Evaluation/Repair

**Grading Affecting Foundation:** 

Condition

Areas with negative grade observed. Recommend evaluation and repair by qualified contractor.

Patio: Condition

Recommend Evaluation/Repair

**Porch: Porch Supports** 

Wood

**Balcony Porch: Walking Surface** 

Condition

Satisfactory

**Siding: Material** 

**Walkways: Condition** 

Recommend Evaluation/Repair

Stoop/Steps: Material

Concrete, Wood

Hose Bib(s): Present/None

Observed

Present

**Driveway/Parking: Material** 

Repair/Evaluate/Maintenance/Monitor

Concrete

Stoop/Steps: Condition

Satisfactory

**Patio: Material** 

Pavers

**Porch: Walking Surface** 

Wood

Satisfactory

**Balcony Porch: Porch Supports** 

Framed walls

**Siding: Condition** 

**Porch: Walking Surface Condition** 

Satisfactory

Porch: Porch Supports Condition Balcony Porch: Walking Surface

Rubber

**Balcony Porch: Porch Supports** 

Condition Satisfactory

Trim: Material

Homewrx Inspections Page 17 of 53 Vinyl

Satisfactory

Vinyl

**Trim: Condition** 

**Soffit: Material** 

**Soffit: Condition** Peeling paint

Satisfactory

Wood

**Gutters: Material** 

Facia: Material Wood

**Facia: Condition** Peeling paint

Metal

**Gutters: Condition** 

**Flashings** 

**Flashings** 

Satisfactory

(windows/doors/sills/ledges):

**Exterior Doors: Rear Door** 

Location: Side of house

(windows/doors/sills/ledges):

Material Vinyl

Condition Satisfactory

**Caulking: Exterior Caulking** 

Recommend caulking gaps

Windows: Type

**Windows: Condition** 

around

Vinyl, Wood

Recommend Evaluation/Repair

windows/doors/ledges/corners/utility penetrations

**Exterior Doors: Main Entrance** 

**Door Condition** 

Satisfactory

**Exterior Doors: Other Door** 

Condition

Condition Fogged pane

Satisfactory

Gas Meter: Gas Meter & Main Fuel Air Conditioning Unit: Location

One or more exterior outlets not Shutoff

NA

**GFCI: GFCI Protection** 

on/powered at time of

inspection. Recommend verifying if outlet is operated by a switch or recommend repair if needed.



Hose Bib(s): Condition

One or more hose bibs were not on

Homewrx Inspections Page 18 of 53





Damaged handle

Covered

#### De ciencies

3.1.1 Walkways

# TRIP HAZARD(S) OBSERVED AT WALKWAYS



Trip hazard(s) observed at walkway. Recommend evaluation/repair by qualified contractor.



3.2.1 Driveway/Parking

# TRIP HAZARD(S) OBSERVED AT DRIVEWAY



Trip hazard(s) observed at driveway. Recommend evaluation/repair by qualified contractor.



Homewrx Inspections Page 19 of 53

3.6.1 Patio

# Other Defects

# AREA(S) AT PATIO ARE PITCHED TOWARD HOME

Areas of patio are pitched toward the home. Recommend establishing and maintaining a positive drainage slope away from home. Recommend evaluation/repair by qualified contractor.




3.8.1 Balcony Porch

#### RAILING AT BALCONY PORCH IS LOOSE/WOBBLY



The railing at the balcony porch is loose/wobbly. Recommend evaluation/repair by qualified contractor.

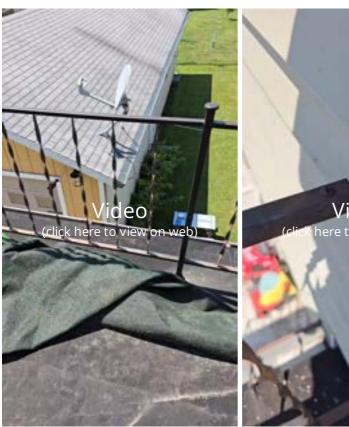



Homewrx Inspections Page 20 of 53

3.11.1 Soffit

## Repair/Evaluate/Maintenance/Monitor

# PEELING PAINT AT EXTERIOR WOODEN SOFFIT/FACIA. (PAINTING IN PROGRESS AT TIME OF INSPECTION)

Recommend ensuring completion of project by qualified contractor and recommend obtaining any paperwork/lien waiver information.



3.16.1 Windows

# CRACKED GLASS OBSERVED AT BASEMENT WINDOW(S)



Cracked glass observed at basement window(s). Recommend evaluation/repair by qualified contractor.



Homewrx Inspections Page 21 of 53

3.16.2 Windows

### **CRACKED GLASS OBSERVED AT WINDOW(S)**



Cracked glass observed at windows. Recommend evaluation/repair by qualified contractor.



3.17.1 Exterior Doors

#### Repair/Evaluate/Maintenance/Monitor **FOGGED WINDOW** PANE(S) OBSERVED AT EXTERIOR DOOR(S)

**REAR DOOR** 

Fogged window pane(s) in door. Recommend evaluation/repair by qualified contractor.



4: ROOF

### **Information**

Visibility **Inspected From** Style Hip, Low slope

Page 22 of 53 Homewrx Inspections

Visibility limited due to roof height and/or pitch

**Ventilation Systems** 

Not visible

**Flashings: Condition** 

Not visible

**Coverings: Estimated Age (years) Coverings: Condition** 

Rubber roofing and asphalt shingles estimated 20+ years old. Slate roofing estimated 50+ years old.

Ground, Ladder At Eves, Lower Portion Of Roof

**Skylights** 

N/A

**Coverings: Material** 

Rubber Roofing, Slate, Asphalt

**Shingles** 

Recommend Evaluation/Repair

Chimney(s): Flue Type (Visible

Portion)

Not Visible

Flashings: Material

Not Visible

**Coverings: Estimated Number of** 

Layers

2+, (Wood Shingles/Shakes

Visible From Attic)

Chimney(s): Viewed From

Ladder at eves



Chimney(s): Chase Type

Brick

Chimney(s): Rain Cap/Spark **Arrestor Present?** 

Nο

**Chimney(s): Condition** 

Visible Areas Appear Satisfactory. Some areas of chimney chase not visible due to roof pitch/height

General

Photo(s)



Homewrx Inspections Page 23 of 53



Homewrx Inspections Page 24 of 53




## De ciencies

4.2.1 Coverings



## CRACKS OBSERVED AT SLATE SHINGLES. (SOME AREAS OF ROOF NOT **VISIBLE FOR INSPECTION)**

Recommend evaluation and repair by qualified contractor

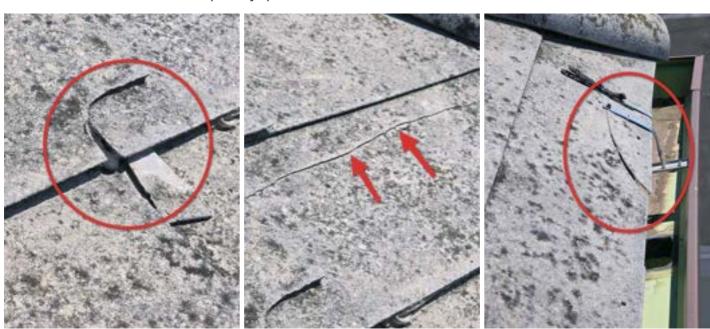

5: DETACHED GARAGE

## **Information**

Page 25 of 53 Homewrx Inspections

**Type: Garage Type** 

Detached

**Roof: Material** 

**Asphalt Shingles** 

**Roof: Estimated Number of** 

Lavers 1+

**Roof: Estimated Age (years)** 

15-20+

**Roof: Condition** 

Satisfactory

**Gutters: Material** 

**Siding: Condition** 

Metal

**Gutters: Condition** 

Satisfactory

Trim: Material

Vinyl, Wood

**Siding: Material** 

Vinyl, Wood

**Trim: Condition** Satisfactory

**Soffit: Material** 

Satisfactory

booW

**Soffit: Condition** 

Satisfactory

Facia: Material

Wood

**Facia: Condition** 

Satisfactory

**Framing: Framing Type** 

Rafters

**Framing: Condition** 

Satisfactory

Windows: Type

booW

**Windows: Condition** 

Satisfactory

**Exterior Service Door: Exterior** 

**Service Door** 

Side door is satisfactory. Front

door is blocked.

Floor: Material

Concrete

Floor: Condition

Satisfactory

**GFCI: GFCI Protection** 

Recommend GFCI Protection For

Enhanced Safety (See Electrical

Section Of Report)

**Overhead Garage Door: Material** 

Metal

**Overhead Garage Door: Condition Automatic Opener: Operable** 

Satisfactory

Yes

**Automatic Opener: Safety** 

Reverse

Recommend Adjusting Pressure Reverse For Enhanced Safety, Recommend installing photo eyes/safety reverse system for

enhanced safety.

### De ciencies

Homewrx Inspections Page 26 of 53 5.14.1 Automatic Opener

#### RECOMMEND PROPER INSTALLATION OF PHOTO EYES



Photo eyes were not present or were not properly positioned at 2" to 6" above floor at garage door threshold. Recommend evaluation/repair by qualified contractor.





6: ATTIC

#### **Information**

**General Information: Access Type General Information: Access** 

**Stairs** 

Location

Closet

**General Information: Flooring** 

Mostly floored

**General Information: Vapor** 

**Barrier** 

Not Visible

**Framing: Type** 

Satisfactory

Rafters

**Attic Insulation: Condition** 

Satisfactory

**Sheathing: Material** 

terial Sheathing: Condition

Planking

**General Information: General** 

Photo(s)

**General Information: Inspected** 

From

In The Attic

**Attic Insulation: Type** 

Blown Cellulose


**Framing: Condition** 

Cracked cross member

**Ventilation: Condition** 

Not Vented

Homewrx Inspections Page 27 of 53

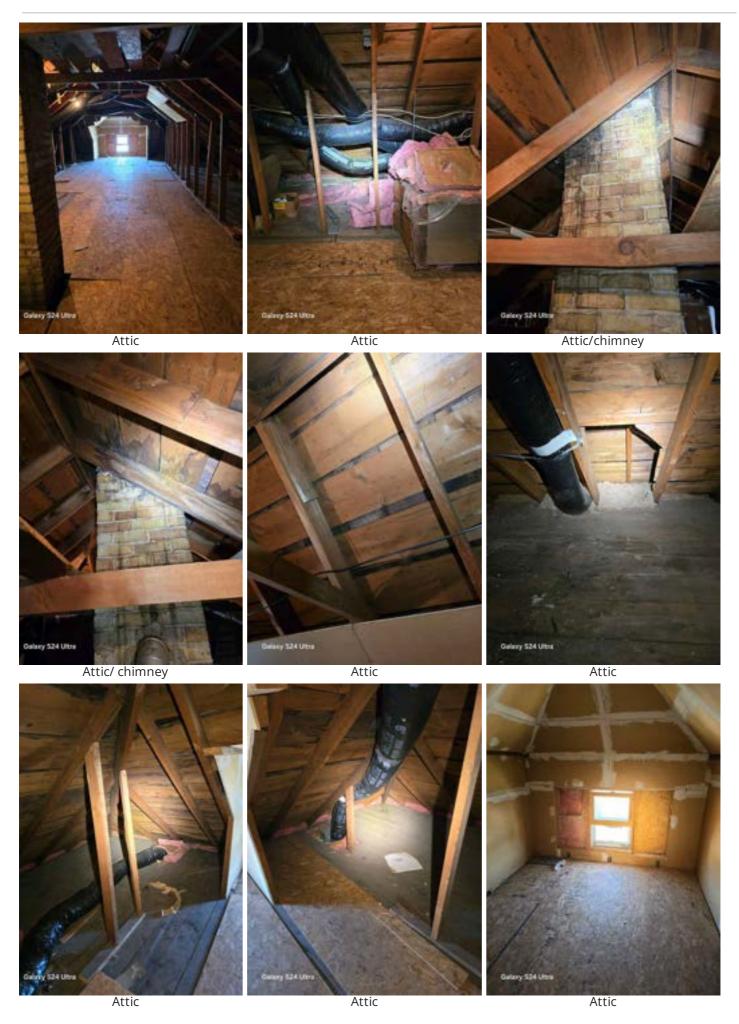

Homewrx Inspections Page 28 of 53



Attic

## De ciencies

6.3.1 Framing

# CRACKED CROSS MEMBER OBSERVED IN ATTIC



Recommend evaluation and repair by qualified contractor



7: BEDROOM


#### Information

**Room: Location**Second Floor, East

Walls & Ceiling: Condition
Satisfactory

**Floors: Condition**Satisfactory

Homewrx Inspections Page 29 of 53

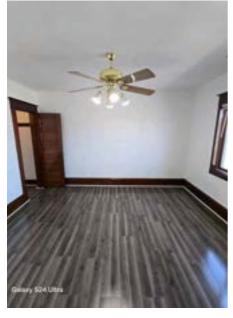

**Door(s): Condition**Doesn't Latch Properly.
Recommend Adjustment/Repair.

**Ceiling Fan: Condition**Satisfactory

**Windows: Condition**Satisfactory

**Bedroom Egress: Egress**Satisfactory


**Heat Source: Heat Source** 

**Present?**Yes

8: BEDROOM 2

## **Information**

**Room: Location**Second Floor, West

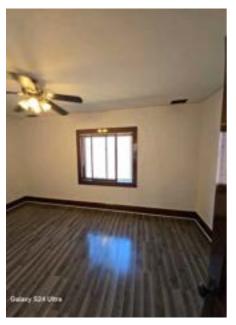

Walls & Ceiling: Condition Satisfactory Floors: Condition
Heaved

Door(s): Condition Windows: Condition

Homewrx Inspections Page 30 of 53

Satisfactory Satisfactory Heat Source: Heat Source

Present? Yes

**Ceiling Fan: Condition** 

Satisfactory

**Bedroom Egress: Egress** 

Satisfactory


#### De ciencies

8.3.1 Floors


# Repair/Evaluate/Maintenance/Monitor

# HEAVED FLOORING OBSERVED IN 2ND FLOOR WEST BEDROOM AND IN BASEMENT AREA(S)

Recommend evaluation and repair by qualified contractor

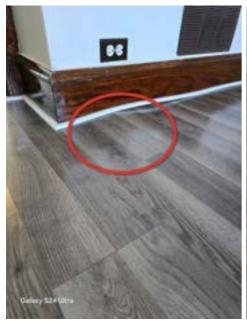



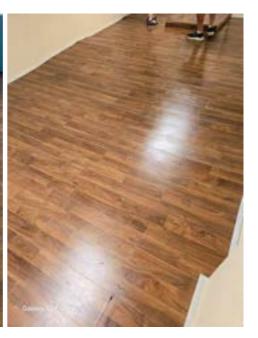

9: BEDROOM 3

## **Information**


**Room: Location**First Floor, East

Walls & Ceiling: Condition

Satisfactory

**Floors: Condition**Satisfactory

Homewrx Inspections Page 31 of 53

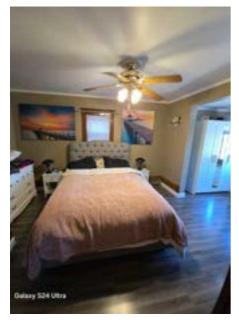

**Door(s): Condition**Satisfactory

**Ceiling Fan: Condition**Satisfactory

**Windows: Condition**Satisfactory

**Bedroom Egress: Egress**Satisfactory


**Heat Source: Heat Source** 

Present? Yes

10: BEDROOM 4

## **Information**

**Room: Location**First Floor, West

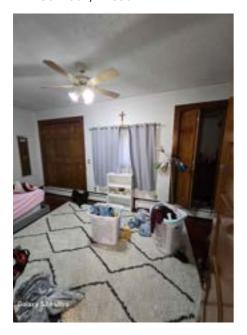

Walls & Ceiling: Condition
Satisfactory

**Floors: Condition**Satisfactory

Door(s): Condition Windows: Condition

Homewrx Inspections Page 32 of 53

Satisfactory

Cracked glass

**Heat Source: Heat Source** 

Present? Yes

**Ceiling Fan: Condition** 

Satisfactory

**Bedroom Egress: Egress** 

Satisfactory

11: BATHROOM

#### **Information**

**General Information: Location** 

Second Floor

Walls & Ceiling: Condition Satisfactory

Floors: Condition Satisfactory



Door(s): Condition Satisfactory

**Bath Fan: Present?** 

Yes

**Windows: Condition** 

N/A

Yes

**Bath Fan: Operable?** 

Sink(s): Plumbing Condition Drained slowly, S-trap observed.

Recommend installation of ptrap by qualified plumber.

**Tub/Shower: Material** 

**Fiberglass** 

**Toilet: Condition** Satisfactory

**Tub/Shower: Condition** 

Satisfactory

**Heat Source: Heat Source** 

Present? Yes

Sink(s): Sink Base Cabinet &

Countertop Satisfactory

**GFCI: GFCI Protection** 

Satisfactory

#### De ciencies

Homewrx Inspections Page 33 of 53 11.8.1 Sink(s)

# Repair/Evaluate/Maintenance/Monitor

#### SECOND FLOOR **BATHEOOM SINK DRAINED SLOWLY**

Sink drained slowly. Recommend evaluation/repair by qualified plumber.



## 12: BATHROOM 2

#### **Information**

Walls & Ceiling: Condition

Satisfactory

**Floors:** Condition

Slopes

Windows: Condition

Satisfactory

**Heat Source: Heat Source** 

Present? Yes

**Bath Fan: Operable?** 

Yes

Sink(s): Sink Base Cabinet &

Countertop Satisfactory

**Toilet: Condition** 

Satisfactory

Satisfactory

**GFCI: GFCI Protection** 

Door(s): Condition

Doesn't Latch Properly.

Recommend Adjustment/Repair.

Bath Fan: Present?

Yes

Sink(s): Plumbing Condition

Recommend Evaluation/Repair

**Tub/Shower: Material** 

**Fiberglass** 

**Tub/Shower: Condition** 

Drain Stopper Missing/Damaged

**General Information: Location** 

First Floor

Homewrx Inspections Page 34 of 53





## De ciencies

12.8.1 Sink(s)

# HANDYMAN PLUMBING OBSERVED BELOW FIRST FLOOR BATHROOM SINKS



Recommend evaluation and repair by qualified contractor






13: LIVING ROOM

## **Information**

Homewrx Inspections Page 35 of 53

1712 S 12th St -

**Room: Location**Second Floor

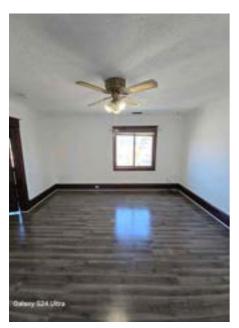

Walls & Ceiling: Condition
Satisfactory

**Floors: Condition**Satisfactory

**Door(s): Condition**Satisfactory

**Ceiling Fan: Condition**Satisfactory

**Windows: Condition**Satisfactory

Heat Source: Heat Source Present?
Yes

14: LIVING ROOM 2

## Information

**Room: Location**First Floor

Walls & Ceiling: Condition
Satisfactory

**Floors: Condition**Satisfactory

Homewrx Inspections Page 36 of 53



**Door(s): Condition**Satisfactory

**Ceiling Fan: Condition**No Fan Present


**Windows: Condition**Cracked glass

Heat Source: Heat Source
Present?
Yes

## 15: DINING ROOM

### **Information**

**Room: Location**Second Floor

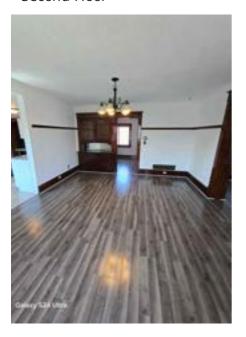

Walls & Ceiling: Condition
Satisfactory

**Floors: Condition**Satisfactory

Door(s): Condition Windows: Condition

Homewrx Inspections Page 37 of 53

Satisfactory

Satisfactory

**Heat Source: Heat Source** 

Present? Yes

**Ceiling Fan: Condition** 

No Fan Present

16: DINING ROOM 2

#### **Information**

**Room: Location** First Floor



Walls & Ceiling: Condition

Satisfactory

**Floors: Condition** Satisfactory

Door(s): Condition Satisfactory

**Ceiling Fan: Condition** 

Satisfactory

**Windows: Condition** Satisfactory

**Heat Source: Heat Source** Present?

Yes

17: ADDITIONAL ROOM

### **Information**

Room: Type **Room: Location** Walls & Ceiling: Condition Rec Room Basement Satisfactory

Page 38 of 53 Homewrx Inspections



**Floors: Condition** Slopes

**Heat Source: Heat Source** Present? Yes, Fins only. No radiator observed

Door(s): Condition Doesn't Latch Properly. Recommend Adjustment/Repair.

**Ceiling Fan: Condition** No Fan Present

**Windows: Condition** Cracked glass

18: KITCHEN

#### **Information**

Walls & Ceiling: Condition

Satisfactory

**Windows: Condition** 

Satisfactory

Floors: Condition

Satisfactory

Present?

Yes

N/A

Operable

Door(s): Condition

Satisfactory

**Ceiling Fan: Condition** 

No Fan Present

**Countertops & Cabinets:** 

**Countertops** Satisfactory

Sink(s): Plumbing Condition

Satisfactory

Appliances: Oven/Range

Operable

**Room: Location** Second Floor

**Heat Source: Heat Source** 

**Countertops & Cabinets: Cabinets GFCI: GFCI Protection** 

Satisfactory

Recommend GFCI Protection For Enhanced Safety (See Electrical

Section Of Report)

**Appliances: Disposal Appliances: Dishwasher** 

N/A

**Appliances: Exhaust Fan** 

N/A

Homewrx Inspections Page 39 of 53

**Appliances: Fridge/Freezer** 







2nd Floor Kitchen

Oven & Range Heated!

Cold Fridge & Freezer!

#### **Appliances: Note**

The Wisconsin Standards of Practice (SOP) do not require an inspector to report on the condition of household appliances. Any comments about appliances are for informational purposes only.

### 19: KITCHEN 2

#### **Information**

Walls & Ceiling: Condition

Moisture stains

**Windows: Condition** 

Satisfactory

**Floors: Condition**Satisfactory

,

**Heat Source: Heat Source** 

Present?

Yes

N/A

**Door(s): Condition**Satisfactory

**Ceiling Fan: Condition** 

Satisfactory

**Countertops & Cabinets:** 

Countertops

Satisfactory

**Countertops & Cabinets: Cabinets GFCI: GFCI Protection** 

Satisfactory

Recommend GFCI Protection For Enhanced Safety (See Electrical

Section Of Report)

Sink(s): Plumbing Condition

Moisture stains observed below

sink

**Appliances:** Fridge/Freezer

**Appliances: Disposal** 

Operable

**Appliances: Dishwasher** 

N/A

Appliances: Oven/Range

Operable

Room: Location
First Floor

**Appliances: Exhaust Fan** 

Operable

Homewrx Inspections Page 40 of 53







1st Floor Kitchen

Cold Fridge & Freezer!

Oven & Range Heated!

#### **Appliances: Note**


The Wisconsin Standards of Practice (SOP) do not require an inspector to report on the condition of household appliances. Any comments about appliances are for informational purposes only.

#### De ciencies

19.2.1 Walls & Ceiling

MOISTURE STAINS/DISCOLORATION OBSERVED ON WALL BELOW 1ST FLOOR KITCHEN SINK AND IN BASEMENT BELOW THAT AREA. (MOISTURE METER INDICATES SOME MOISTURE CONTENT PRESENT IN WALL)

Recommend evaluation and repair by qualified contractor

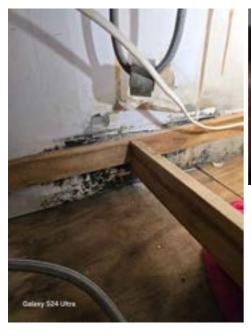





Homewrx Inspections Page 41 of 53 19.11.1 Appliances



## RANGE EXHAUST HOOD IS LOCATED <18" ABOVE STOVETOP

The range exhaust hood is located less than 18 inches above the stovetop. Recommend evaluation/repair by qualified contractor.



## 20: LAUNDRY AREA

#### **Information**

**Laundry Sink: Plumbing** 

Condition

N/A

**Dryer: Gas Line Present?** 

No

**General Information: Location** 

Basement

Washer: Washer Hookup Valves

Satisfactory

**Dryer: Dryer Vented Through** 

Wall





Homewrx Inspections Page 42 of 53

**Dryer: 240V Receptacle Present?** 

Yes

#### De ciencies

20.1.1 General Information

## CLOTHES CHUTE IS A POTENTIAL FALL HAZARD FOR CHILDREN/SMALL PETS

Recommend evaluation and repair by qualified contractor





## 21: STAIRS/HANDRAILS/GUARDRAILS

#### **Information**

Stairs/Handrails/Guardrails: Stairs Stairs/Handrails/Guardrails:

Basement stairs are slanted

**Handrail(s)**Satisfactory

Stairs/Handrails/Guardrails: Guardrail(s) Satisfactory

#### De ciencies

21.1.1 Stairs/Handrails/Guardrails

#### BASEMENT STAIRS ARE SLANTED.

Recommend evaluation and repair by qualified contractor





22: SMOKE & CO

Homewrx Inspections Page 43 of 53

#### **Information**

#### **Detectors: Condition**

Alarm(s) Sounded When Test Button(s) Were Pressed

It is recommended to maintain working smoke and CO detectors on each level of the home and in hallway/common area near sleeping areas. Recommend replacing expired detectors and recommend installing new batteries in existing detectors prior to occupying the property. It is also recommended to maintain working combustible gas detectors on each level of the home where gas lines or combustion appliances are present.

### 23: BASEMENT

#### **Information**

**Foundation Walls: Material** 

Brick

**Foundation Walls: Movement** 

**Observed** 

Yes

**Support Structure: Basement** 

**Floor Material** 

Concrete, Finished Flooring In

Areas

**Support Structure: Girder Beam** 

Condition

Satisfactory

**Support Structure: Joist Material** 

Wood

**Support Structure: Sub-Floor** 

Condition

Satisfactory

Foundation Walls: General

Basement/Foundation Photo(s)

Foundation Walls: Walls That Are Foundation Walls: Cracks

**Fully or Partially Covered** Observed

North, South, East, West

**Foundation Walls: Indication Of** Foundation Walls: Condition

Yes

Moisture

**Old Stains** 

**Support Structure: Basement** 

**Floor Condition** 

Heaved flooring. Recommend

Recommend Evaluation/Repair

repair.

**Support Structure: Column** 

Material

**Brick Wall** 

Condition

Condition

Material

Temporary Columns -Recommend Anchoring

**Support Structure: Column** 

Recommend Evaluation/Repair

Support Structure: Girder Beam


Brick Wall In Liu Of Girder Beam

**Support Structure: Joist Support Structure: Sub-Floor** 

Material

Mood

Homewrx Inspections Page 44 of 53

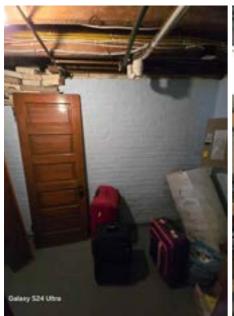





**Foundation Photos** 

**Foundation Photos** 

**Foundation Photos** 







**Foundation Photos** 

Foundation Photos/cracks

Foundation Photos/ old moisture stains



Page 45 of 53 Homewrx Inspections

Foundation Photos/ old moisture stains

#### De ciencies

23.1.1 Foundation Walls

# LOOSE BRICKS/DAMAGED AREA OBSERVED AT FOUNDATION WALL

Recommend evaluation and repair by qualified contractor



23.2.1 Support Structure

## MODIFIED/DAMAGED FLOOR JOIST(S) OBSERVED

Other Defects

Recommend evaluation and repair by qualified contractor



Homewrx Inspections Page 46 of 53

23.2.2 Support Structure

#### TEMPORARY/UNANCHORED COLUMNS OBSERVED IN BASEMENT.



Recommend anchoring/repair by qualified contractor.





24: PLUMBING

#### **Information**

Water Entry & Main Water **Shutoff: Water Entry Pipe** Material

Plastic

**Water Supply & Drain Piping: Water Distribution Piping** Condition

Marginal - Based On Age

Fuel Line: Fuel Line Material Black Iron

Water Entry & Main Water Shutoff: Location

Basement

Water Entry & Main Water **Shutoff: Pressure Tank** N/A

Water Supply & Drain Piping: **Drain, Waste & Vent Piping** Material

PVC, Cast Iron

**Fuel Line: Condition** 

Satisfactory

**Water Supply & Drain Piping: Water Distribution Piping** Material

Copper, Galvanized

Water Supply & Drain Piping: Condition

Corroded Areas - Recommend Monitoring For Leaks, Marginal -Based On Age

Homewrx Inspections Page 47 of 53





#### De ciencies

24.2.1 Water Supply & Drain Piping

#### Repair/Evaluate/Maintenance/Monitor FURTHER EVALUATION -OR- MONITOR/BUDGET ITEM - GALVANIZED AND/OR CAST IRON PLUMBING PIPES ARE BEYOND NORMAL LIFE **EXPECTANCY**

Galvanized and/or cast iron plumbing pipes are beyond normal life expectancy. Recommend monitoring for leaks/blockages and recommend budgeting for repairs or replacement at any time. Inspector cannot determine the condition of pipes under the concrete and the underground lateral. Recommend further evaluation and sewer scoping by qualified plumber.





25: WATER HEATER

Homewrx Inspections Page 48 of 53

#### **Information**

Water Heater: Brand

GΕ

**Water Heater: Approximate** 

Age/Year Built

2008

Water Heater: Type

Gas

Water Heater: Relief Valve/Extension

Satisfactory

Water Heater: Condition

Marginal - Based On Age

Water Heater 2: Brand

Rheem

Water Heater 2: Capacity

40 Gallons

Water Heater 2: Type

Gas

Water Heater 2: Vent Pipe

Satisfactory

**Water Heater 2: Condition** 

Marginal - Based On Age

**Water Heater: Capacity** 

50 Gallons

Water Heater: Vent Pipe

Satisfactory

**Water Heater 2: Approximate** 

Age/Year Built

2014

Water Heater 2: Relief

Valve/Extension

Satisfactory

#### De ciencies

25.1.1 Water Heater

#### Repair/Evaluate/Maintenance/Monitor MONITOR/BUDGET ITEM - WATER HEATER IS NEARING OR BEYOND **NORMAL LIFE EXPECTANCY**

MANUFACTURED IN 2008

The water heater is nearing (within 5 years of) or beyond normal life expectancy (based on 10-year average life expectancy). Recommend monitoring the water heater and recommend budgeting for repairs or replacement at any time.




Homewrx Inspections Page 49 of 53 25.2.1 Water Heater 2

### Repair/Evaluate/Maintenance/Monitor MONITOR/BUDGET

#### ITEM - WATER HEATER IS NEARING OR BEYOND **NORMAL LIFE EXPECTANCY**

MANUFACTURED IN 2014

The water heater is nearing (within 5 years of) or beyond normal life expectancy (based on 10-year average life expectancy). Recommend monitoring the water heater and recommend budgeting for repairs or replacement at any time.

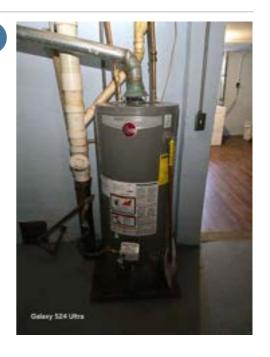

## 26: HEATING SYSTEM

#### **Information**

**Furnace:** Approximate Age/Year

Estimated 20+ Years

**Furnace: Electric Disconnect (In** Same Room & Within 6' of

**Heating System**)

Screw out fuse present

Furnace: Exhaust/Flue Piping

Satisfactory

**Furnace: Condition** 

Marginal (Based on Age)

**Boiler: Energy Source** 

Gas

Boiler: Fuel Shutoff (In Same

Room & Within 6' of Heating

System) Present **Furnace: Energy Source** 

Gas

Furnace: Fuel Shutoff (In Same Room & Within 6' of Heating

System)

Present

**Furnace: Filter** 

Standard, 14x20x1

**Boiler: Brand** 

Burnham

**Boiler: Heat Exchanger** 

Not Readily

Observable/Accessible - Not

Inspected

**Boiler: Distribution System** 

Hot Water

**Furnace: Heat Exchanger** 

Not Readily

Observable/Accessible - Not

Inspected

**Furnace: Distribution System** 

Metal Duct

**Furnace: Operation** 

Fired when turned on by

thermostat

**Boiler:** Approximate Age/Year

Built

Estimated 1987 to 1993 based on

ansi date of 1987

**Boiler: Electric Disconnect (In** Same Room & Within 6' of

**Heating System**)

Present

**Boiler**: Circulator

Pump

Homewrx Inspections Page 50 of 53

**Boiler: Pressure Relief** 

**Boiler : Exhaust/Flue Piping**Satisfactory

Boiler : Operation

Recommend Evaluation/Repair

Fired when turned on by

thermostat

**Boiler: Condition** 

Marginal (Based on Age)

#### De ciencies

26.1.1 Furnace



## MONITOR/BUDGET ITEM - NEARING OR BEYOND NORMAL LIFE EXPECTANCY

The furnace is nearing (within 5 years of) or beyond normal life expectancy (based on 18-year average life expectancy). Recommend monitoring the operation of the furnace and recommend budgeting for repairs or replacement at any time.







Furnace Furnace

Heating

Homewrx Inspections Page 51 of 53

26.2.1 Boiler

## Repair/Evaluate/Maintenance/Monitor

## FURTHER EVALUATION/ MONITOR/BUDGET ITEM - NEARING OR BEYOND NORMAL LIFE EXPECTANCY

The boiler is nearing (within 5 years of) or beyond normal life expectancy (based on 15-year average life expectancy for high efficiency boilers and based on 25-year average life expectancy for atmospheric vented boilers). Recommend monitoring the operation of the boiler and recommend budgeting for repairs or replacement at any time. Debris was observed inside of burner chamber. Recommend clean/tune by qualified contractor.







Boiler Burners Engaged



Debris observed in burner cabinet. Recommend clean/tune by qualified HVAC technician

Homewrx Inspections Page 52 of 53

26.2.2 Boiler



# MISSING/IMPROPER EXTENSION PIPE AT PRESSURE RELIEF VALVE

Missing/Improper extension pipe at pressure relief valve. Recommend evaluation/repair by qualified plumber.



Homewrx Inspections Page 53 of 53